



Type: WT19

Diameter: 19mm

Gauge , Absolute, Sealed Gauge Pressure
Range: 20Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTF19

Diameter: 19mm

Gauge , Absolute, Sealed Gauge Pressure
Range: 20Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTG19

Diameter: 19mm


Gauge , Absolute, Sealed Gauge Pressure
Range: 2Kpa, 7Kpa, 10Kpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 20\text{mV}$ (Typical)
Compensation temperature: 0°C to 55°C
Operating temperature: -45°C to 125°C



Type: WTT19

Diameter: 19mm

Gauge , Absolute, Sealed Gauge Pressure
Range: 20Kpa to 4Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C

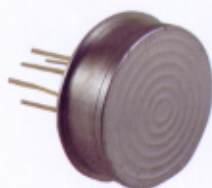

Type: WT17

Diameter: 17mm

Gauge , Absolute, Sealed Gauge Pressure
Range: 100Kpa to 2Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 30\text{mV}$ (Typical)
Compensation temperature: 0°C to 55°C
Operating temperature: -45°C to 125°C



Type: WT16

Diameter: 16mm

Gauge , Absolute, Sealed Gauge Pressure
Range: 100Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTH 19

Diameter: 19mm

Material: **Hastelloy (anticorrosion)**


Gauge , Absolute, Sealed Gauge Pressure
Range: 35Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTD19

Diameter: 19mm

Differential Pressure
Range: 35Kpa to 2Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 80\text{mV}$ (Typical)
Compensation temperature: 0°C to 55°C
Operating temperature: -45°C to 125°C

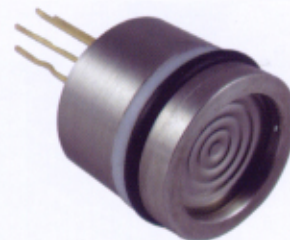

Type: WT15

Diameter: 15mm

Gauge , Absolute, Sealed Gauge Pressure
Range: 1Mpa to 60Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: 0°C to 55°C
Operating temperature: -45°C to 125°C



Type: WT13

Diameter: 13mm

Gauge, Absolute, Sealed Gauge Pressure
Range: 2.5Mpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WT 10

Diameter: 10mm

Absolute Pressure
Range: 25Mpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTF50

Diameter: 50.4mm

Gauge, Absolute, Sealed Gauge Pressure
Range: 20Kpa to 6Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTP01

Gauge, Absolute, Sealed Gauge Pressure
Range: 20Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTP02

Gauge, Absolute, Sealed Gauge Pressure
Range: 35Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTP03

Gauge, Absolute, Sealed Gauge Pressure
Range: 20Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTP04

Gauge, Absolute, Sealed Gauge Pressure
Range: 35Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTP05

Gauge, Absolute, Sealed Gauge Pressure
Range: 20Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C



Type: WTP06

Gauge, Absolute, Sealed Gauge Pressure
Range: 20Kpa to 100Mpa
Supply: 1.5mA(Typical), 1mA, 5V, 10V
Accuracy: $\pm 0.25\%$ F.S.
Output: $\geq 100\text{mV}$ (Typical)
Compensation temperature: -10°C to 70°C
Operating temperature: -45°C to 125°C




Type: WTP07

Gauge, Absolute, Sealed Gauge Pressure
 Range: 20Kpa to 100Mpa
 Supply: 1.5mA(Typical), 1mA, 5V, 10V
 Accuracy: $\pm 0.25\%$ F.S.
 Output: $\geq 100\text{mV}$ (Typical)
 Compensation temperature: -10°C to 70°C
 Operating temperature: -45°C to 125°C




Type: WTP08

Gauge, Absolute, Sealed Gauge Pressure
 Range: 100Kpa to 100Mpa
 Supply: 1.5mA(Typical), 1mA, 5V, 10V
 Accuracy: $\pm 0.25\%$ F.S.
 Output: $\geq 100\text{mV}$ (Typical)
 Compensation temperature: -10°C to 70°C
 Operating temperature: -45°C to 125°C

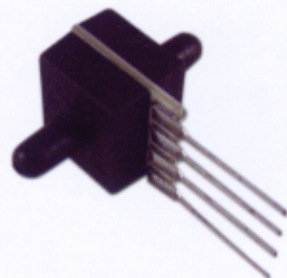


Type: WT22

Differential Pressure
 Range: -100Kpa to 2.5Mpa
 Supply: 1.5mA(Typical), 1mA, 5V, 10V
 Accuracy: $\pm 0.25\%$ F.S.
 Output: $\geq 100\text{mV}$ (Typical)
 Operating temperature: -45°C to 125°C

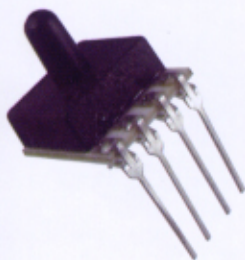


Type: WT23

Gauge Pressure
 Range: -100Kpa to 2.5Mpa
 Supply: 1.5mA(Typical), 1mA, 5V, 10V
 Accuracy: $\pm 0.25\%$ F.S.
 Output: $\geq 70\text{mV}$ (Typical)
 Operating temperature: -45°C to 125°C

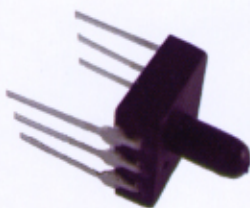

Type: WT24

Gauge Pressure
 Range: -100Kpa to 2.5Mpa
 Supply: 1.5mA(Typical), 1mA, 5V, 10V
 Accuracy: $\pm 0.25\%$ F.S.
 Output: $\geq 100\text{mV}$ (Typical)
 Operating temperature: -45°C to 125°C

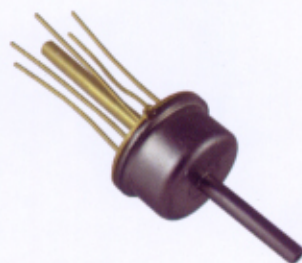

Type: WT25

Gauge, Absolute, Sealed Gauge Pressure
 Range: 20Kpa to 1Mpa
 Supply: 1.5mA(Typical), 1mA, 5V, 10V
 Accuracy: $\pm 0.25\%$ F.S.
 Output: $\geq 50\text{mV}$ (Typical)
 Operating temperature: -45°C to 125°C



Type: WTR01

Gauge, Absolute, Sealed Gauge Pressure
 Range: 20Kpa to 100Mpa
 Supply: 24VDC(Typical)
 Accuracy: $\pm 0.25\%$ F.S.
 Output: 4 to 20mA, 0 to 5V, 1 to 5V
 Compensation temperature: -10°C to 70°C
 Operating temperature: -45°C to 85°C



Type: WTR02

Gauge, Absolute, Sealed Gauge Pressure
 Range: 35Kpa to 100Mpa
 Supply: 24VDC(Typical)
 Accuracy: $\pm 0.25\%$ F.S.
 Output: 4 to 20mA, 0 to 5V, 1 to 5V
 Compensation temperature: -10°C to 70°C
 Operating temperature: -45°C to 125°C



Type: WTR04

Differential Pressure
 Range: 10Kpa to 6Mpa
 Supply: 24VDC(Typical)
 Accuracy: $\pm 0.25\%$ F.S.
 Output: 4 to 20mA, 0 to 5V, 1 to 5V
 Compensation temperature: -10°C to 70°C
 Operating temperature: -45°C to 125°C



Type: WTR05

Differential Pressure

Range: 1Kpa to 600Kpa

Supply: 24VDC(Typical)

Accuracy: $\pm 0.25\%$ F.S.

Output: 4 to 20mA, 0 to 5V, 1 to 5V

Compensation temperature: -10°C to 70°C

Operating temperature: -45°C to 125°C



Type: WTR10

Gauge, Absolute, Sealed Gauge Pressure

Range: 20Kpa to 100Mpa

Supply: 1.5mA(Typical), 1mA, 5V, 10V

Accuracy: $\pm 0.25\%$ F.S.

Output: 0 to 5V, 1 to 5V

Compensation temperature: -10°C to 70°C

Operating temperature: -45°C to 125°C



Type: WTR11

Gauge, Absolute, Sealed Gauge Pressure

Range: 20Kpa to 6Mpa

Supply: 24VDC(Typical)

Accuracy: $\pm 0.25\%$ F.S.

Output: 4 to 20mA, 0 to 5V, 1 to 5V

Compensation temperature: -10°C to 70°C

Operating temperature: -45°C to 125°C



Type: WTL01

Range: 1m to 200m

Supply: 24VDC(Typical)

Accuracy: $\pm 0.25\%$ F.S.

Output: 4 to 20mA, 0 to 5V, 1 to 5V

Compensation temperature: 0°C to 70°C



Type: WTW01

Load Cell

Range: 50N to 500KN

Linearity: $\pm 0.05\%$ FS

Repeatability: $\pm 0.05\%$ FS

Total Accuracy: $\pm 0.05\%$ F.S.

Zero: $\pm 5\%$ FS



Type: WTW02

Load Cell

Range: 5Kg to 50T

Output: 2mV, 0 to 5V, 4 to 20mA

Linearity: $\pm 0.05\%$ FS

Repeatability: $\pm 0.05\%$ FS

Hysteresis: $\pm 0.05\%$ FS

Zero: $\pm 5\%$ FS